

J24 Tuning Chart

Wind	Caps	Lowers	Caps +/- Turns from base	Lowers +/- turns from base
0-5	16	10	-4	-2
5-10	19	13	-2	-2
8-12	21	16	0	0
10-14	23	20	4	2
12-16	25	23	5	3
16+	25	27	5	6

Mast Step location:

From bottom bolt measure back 107.75" and mark step. Then measure back 4.75" to mast. Look up the mast to make sure you have measurable prebend. If the mast is too straight, put the mast back .25"-.5".

Notes:

Numbers reflect the use of the Loos Gauge Model PT-2.

If you error, you'll error on the lighter side of the tune numbers.

Number of turns reflect 1/2 turns on the open barrel turnbuckles

-Ronstan-style are close, but you'll want to correlate with the Loos numbers